



Blueprint



Boots



Camel



Cool Grey




Ebony



Grey



Ice

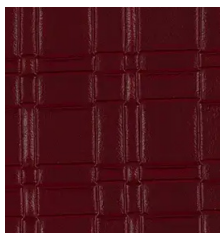

Merlot



Pumice



Saddle



Slate

Construction	Values	Test Method
Surface Composition	100% PVC	ASTM D 751-06
Backing Composition	100% Polyester	ASTM D 751-06
Finished Width	54" min.	ASTM D 751-06
Repeat	None	
Railroaded	No	
Put-up	30 yards	
Cleaning Code	W	

Performance	Values	Test Method
Grab Tensile	175 lbs./in. × 137 lbs./in. min.	ASTM D 751-06
Trap Tear	18 lbs./in. × 12 lbs./in. min.	ASTM D 751-06
Seam Strength	82 lbs./in. × 64 lbs./in. min.	ASTM D 751-06
Adhesion	8 lbs./in. × 7 lbs./in. min.	ASTM D 751-06
Stretch @15# (MD×CD)	2% × 3%	ASTM D 751-06
Flex Resistance	25,000 cycles	ASTM D 2097-03(2010)
Blocking	No. 1 – Pass	FTMS 191A-TM5872
Crock Resistance	Dry-4-5; Wet-4-5	AATCC TM8-2016e
Cold Crack	5# Roller Method, -40°F	CFFA-6A
Wyzenbeek Abrasion	100,000 cycles, #10 cotton duck	ASTM D 4157-2013
UV Stability	200 hours	ASTM D 4329-21

Flammability		Environmental	
California Technical Bulletin 117-2013, Sec. 1	Pass	1. Phthalate free	
NFPA 260	Pass	2. REACH Compliant	
U.F.A.C. Class I	Pass	3. No FR chemicals	
		4. No antimicrobial chemicals	
		5. VOC-CA 01350-Pass	

Suitable Applications Commercial

Cleaning and Disinfecting

Remove ordinary dirt and smudges with mild soap and water. A 10:1 ratio of water to bleach solution may be used as a disinfectant. Rinse the surface with clean water after disinfecting. Dry with a soft, lint-free cloth or towel.

