




Abalone

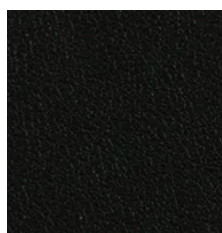


Abyss

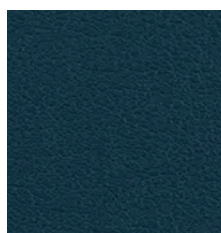


Allure

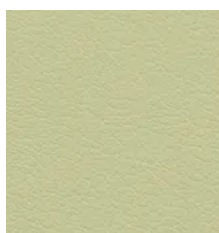


Alpine

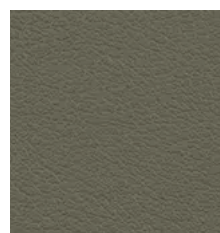

Basalt

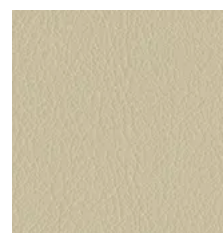

Bisque

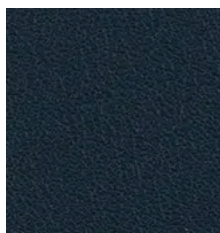

Blueberry




Caramel




Cerulean




Clay

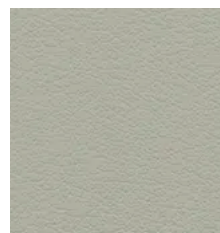


Cloud

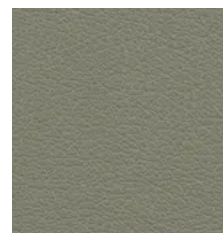


Concrete

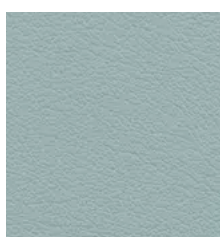

Deep Sky

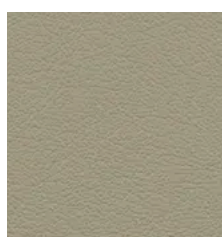


Forage

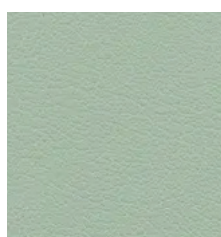


Fountain




Golden

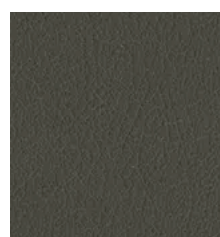


Gotham

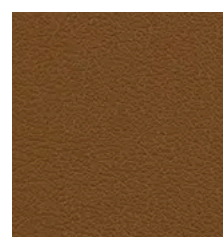


Java

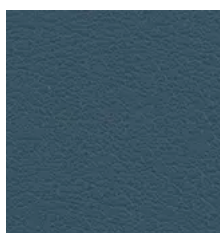


Lavender

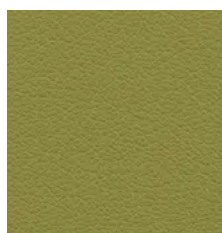


Meadow

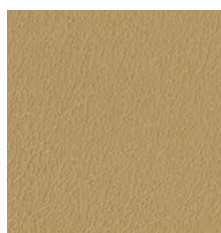


Pecan

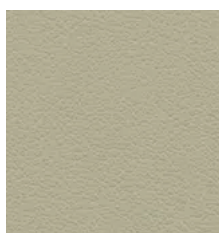


Pewter

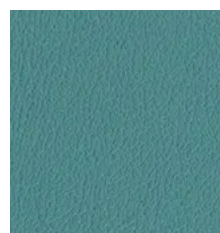

Provence

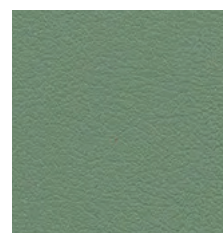

Seagreen

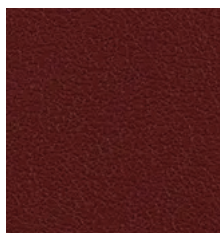


Singria




Sumerian



Tandoori

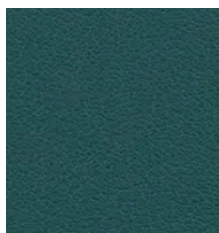

Tealness

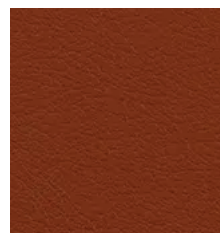

Terra



Yale

Construction	Values	Test Method
Surface Composition	60% Polycarbonate / 40% Polyether	
Finished Width	54" min.	
Backing Composition	100% Polyester	ASTM D 751-06
Put-up	30 yards	ASTM D 751-06
Repeat	None	
Cleaning Code	WS	
Railroaded	No	
Performance	Values	Test Method
Adhesion	4 lbs./in. × 4 lbs./in. min.	ASTM D 751-06
Grab Tensile	120 lbs./in. × 100 lbs./in. min.	ASTM D 751-06
Trap Tear	20 lbs./in. × 20 lbs./in. min.	ASTM D 751-06
Seam Strength	40 lbs./in. × 40 lbs./in. min.	ASTM D 751-06
Stretch at 15# MD (warp) × CD (fill)	8% × 12%	SAE J855, 2002
Flex Resistance	25,000 cycles	ASTM D 2097-91
Blocking	No. 1 – Pass	FTMS 191A-TM5872
Crock Resistance	Dry – 4; Wet – 4	AATCC 8-2007
Wyzenbeek Abrasion (#10 Cotton Duck)	300,000 cycles	ASTM D 4157-13
Hydrolysis Resistance	15 weeks	ISO 1419: 1995, Method C
Colorfastness to Light	650 hours	ASTM D 4329-05
Blue Dye Transfer Resistance	Dry – 4-5; Wet – 4-5	LP-463KC-04-03
Cold Crack (5# roller)	-20°F	CFFA-6A

Flammability

California Technical Bulletin 117-2013, Sec. 1	Pass
FMVSS/CMVSS #302	Pass
IMO A.652(16)8.2	Pass
NFPA 260	Pass
U.F.A.C. Class I	Pass

Environmental

1. No anti-microbial additives
2. Does not contain PFAS, PFOA
3. Prop 65 compliant
4. No chemical flame retardants, CA AB2998 compliant
5. REACH, RoHS, and LEED compliant

Suitable Applications Contract, Healthcare, Hospitality, Residential

Cleaning and Disinfecting

Remove ordinary dirt and smudges with mild soap and water. A 10:1 ratio of water to bleach solution may be used as a disinfectant. Rinse the surface with clean water after disinfecting. Dry with a soft, lint-free cloth or towel. We recommend that you use Clorox Healthcare and Clorox Pro products to disinfect Mitchell products in commercial settings.

